CMSH-SQUICH® 3 + 2 (aux) poles + ⊕ 16A - 830V

enclosures: size "57.27"	page:
C-TYPE IP65 or IP66/IP69	393 - 401
C7 IP67, two levers	438
V-TYPE IP65 or IP66/IP69, single lever	448 - 453
BIG hoods	468 - 469
T-TYPE IP65 insulating	482 - 483
T-TYPE / W IP66/IP69 insulating	490
HYGIENIC T-TYPE / H IP66/IP69	502
HYGIENIC T-TYPE / C IP66/IP69, -50 °C	507
W-TYPE for aggressive environments	522
E-Xtreme® corrosion proof 532 - 533, 543,	552 - 553
EMC	579
Central lever	606 - 608
LS-TYPE	620 - 621
IP68	636 - 639
panel supports:	nago:
COB	page: 652 - 653
000	002 - 000

inserts. spring terminal connection without tools



Q SILVER PLATED CONTACTS

description

part No.

spring terminals with actuator button female inserts with female contacts

male inserts with male contacts

- characteristics according to EN 61984:

16A 830V 8kV 3 1000V 8kV 2 16A 720/1250V 8kV 2


- auxiliary contacts: 16A 500V 6kV

- c Nus (UL for USA and Canada), cec

EHL certified

- rated voltage according to UL/CSA: 600V - insulation resistance: ≥ 10 GΩ
- ambient temperature limit: -40 °C ... +125 °C
- made of self-extinguishing thermoplastic resin UL 94V-0
- mechanical life: ≥ 500 cycles
- contact resistance: ≤ 3 mΩ
- for max. current load see the connector inserts derating diagram below; for more information see page 28

CMSHF 03 CMSHM 03

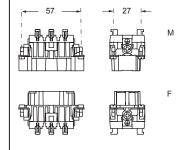

contacts side (front view)



the auxiliary contacts are in the forward position upon opening

- inserts for conductor cross-sections: 0.14 - 2.5 mm² - AWG 26 - 14
- conductors stripping lenght: 9...11 mm

SQUICH®-spring connection technology

WIRING



Deeply insert a stripped conductor into a round terminal.




Push the actuator button to close the terminal.

RE-OPENING



Insert a **0,5 x 3,5 mm** flat blade screwdriver in the actuator button side window and pull it up by levering down.

CMSH 03 poles connector inserts Maximum current load derating diagram

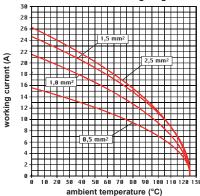

CMSH-SQUICH® 6 + 2 (aux) poles + ⊕ 16A - 830V

enclosures: size "77.27"	page:
C-TYPE IP65 or IP66/IP69	402 - 411
C7 IP67, two levers	439 - 440
V-TYPE IP65 or IP66/IP69, single lever	454 - 458
BIG hoods	470 - 471
T-TYPE IP65 insulating	484 - 485
T-TYPE / W IP66/IP69 insulating	491
HYGIENIC T-TYPE / H IP66/IP69	503
HYGIENIC T-TYPE / C IP66/IP69, -50 °C	508
W-TYPE for aggressive environments	523
E-Xtreme® corrosion proof 534 - 535, 544,	554 - 555
EMC	580
Central lever	609 - 611
LS-TYPE	622 - 623
IP68	640 - 643
panel supports:	page:
COB	652 - 653

inserts. spring terminal connection without tools



Q SILVER PLATED CONTACTS

description

part No.

spring terminals with actuator button female inserts with female contacts

- characteristics according to EN 61984:

male inserts with male contacts

16A 830V 8kV 3 1000V 8kV 2 16A 720/1250V 8kV 2


- auxiliary contacts: 16A 500V 6kV

- c Nus (UL for USA and Canada), cec




- rated voltage according to UL/CSA: 600V
- insulation resistance: ≥ 10 GΩ
- ambient temperature limit: -40 °C ... +125 °C - made of self-extinguishing thermoplastic resin
- UL 94V-0
- mechanical life: ≥ 500 cycles
- contact resistance: ≤ 3 mΩ
- for max. current load see the connector inserts derating diagram below; for more information see page 28

CMSHF 06 CMSHM 06

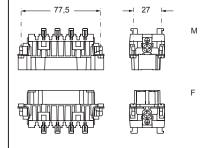

contacts side (front view)

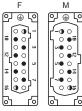

the auxiliary contacts are in the forward position upon opening

- inserts for conductor cross-sections: 0,14 - 2,5 mm² - AWG 26 - 14
- conductors stripping lenght: 9...11 mm

SQUICH®-spring connection technology

WIRING



Deeply insert a stripped conductor into a round terminal.




Push the actuator button to close the terminal.

RE-OPENING



Insert a **0,5 x 3,5 mm** flat blade screwdriver in the actuator button side window and pull it up by levering down.

CMSH 06 poles connector inserts Maximum current load derating diagram

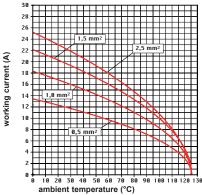

CMSH-SQUICH® 10 + 2 (aux) poles + ⊕ 16A - 830V

enclosures: size "104.27"	page:
C-TYPE IP65 or IP66/IP69	412 - 423
C7 IP67, two levers	441 - 442
V-TYPE IP65 or IP66/IP69, single lever	459 - 463
BIG hoods	472 - 473
T-TYPE IP65 insulating	486 - 487
T-TYPE / W IP66/IP69 insulating	492
HYGIENIC T-TYPE / H IP66/IP69	504
HYGIENIC T-TYPE / C IP66/IP69, -50 °C	509
W-TYPE for aggressive environments	524
E-Xtreme® corrosion proof 536 - 537, 545,	556 - 557
EMC	581
Central lever	612 - 614
LS-TYPE	624 - 625
IP68	644 - 647
panel supports:	page:
СОВ	652 - 653

inserts. spring terminal connection without tools



Q SILVER PLATED CONTACTS

description

part No.

spring terminals with actuator button female inserts with female contacts male inserts with male contacts


- characteristics according to EN 61984:

16A 830V 8kV 3 1000V 8kV 2 16A 720/1250V 8kV 2


- auxiliary contacts: 16A 500V 6kV
- c Nus (UL for USA and Canada), cec

- rated voltage according to UL/CSA: 600V
- insulation resistance: ≥ 10 GΩ
- ambient temperature limit: -40 °C ... +125 °C
- made of self-extinguishing thermoplastic resin UL 94V-0
- mechanical life: ≥ 500 cycles
- contact resistance: ≤ 3 mΩ
- for max. current load see the connector inserts derating diagram below; for more information see page 28

CMSHF 10 CMSHM 10

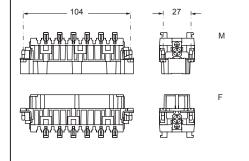

contacts side (front view)

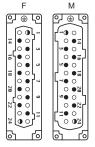


the auxiliary contacts are in the forward position upon opening

- inserts for conductor cross-sections:
- 0,14 2,5 mm² AWG 26 14 conductors stripping lenght: 9...11 mm

SQUICH®-spring connection technology

WIRING

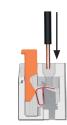

Deeply insert a stripped conductor into a round terminal.




Push the actuator button to close the terminal.

RE-OPENING



Insert a **0,5 x 3,5 mm** flat blade screwdriver in the actuator button side window and pull it up by levering down.

CMSH 10 poles connector inserts Maximum current load derating diagram

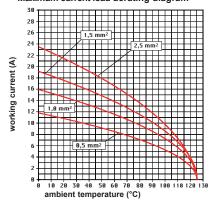


CMSH-SQUICH® 12 + 4 (aux) poles + (aux) poles + (b) 16A - 830V

enclosures: size "77.62"

page:

C-TYPE IP65 or IP66/IP69 424 - 429 W-TYPE for aggressive environments E-Xtreme® corrosion proof 525 546 inserts. spring terminal connection without tools

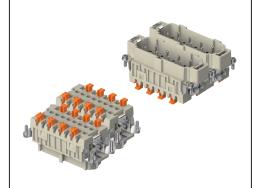

Q SILVER PLATED CONTACTS

part No. description part No.

spring terminals with actuator button female inserts with female contacts, No. (1-16) and (17-32) male inserts with male contacts, No. (1-16) and (17-32)

CMSHF 06 CMSHM 06 CMSHF 06 N CMSHM 06 N

- characteristics according to EN 61984:


16A 830V 8kV 3 16A 1000V 8kV 2 16A 720/1250V 8kV 2

- auxiliary contacts: 16A 500V 6kV


- c Sus (UL for USA and Canada), cec

Eff certified

- rated voltage according to UL/CSA: 600V
- insulation resistance: ≥ 10 GΩ
- ambient temperature limit: -40 °C ... +125 °C
- made of self-extinguishing thermoplastic resin UL 94V-0
- mechanical life: ≥ 500 cycles
- contact resistance: ≤ 3 mΩ
- for max. current load see the connector inserts derating diagram below; for more information see page 28

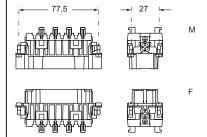

contacts side (front view)

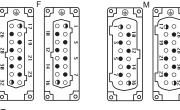


the auxiliary contacts are in the forward position upon opening

- inserts for conductor cross-sections: 0,14 - 2,5 mm² - AWG 26 - 14
- conductors stripping lenght: 9...11 mm

SQUICH®-spring connection technology

WIRING

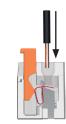

Deeply insert a stripped conductor into a round terminal.




Push the actuator button to close the terminal.

RE-OPENING



Insert a **0,5 x 3,5 mm** flat blade screwdriver in the actuator button side window and pull it up by levering down.


CMSH 12 poles connector inserts Maximum current load derating diagram

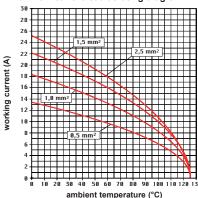

CMSH-SQUICH® 20 + 4 (aux) poles + (aux) pole

enclosures: size "104.62" page: C-TYPE IP65 or IP66/IP69 430 W-TYPE for aggressive environments E-Xtreme® corrosion proof 526 547

inserts. spring terminal connection without tools

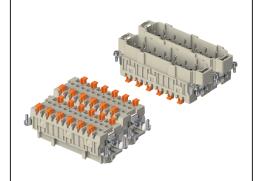

Q SILVER PLATED CONTACTS

description part No. part No.

spring terminals with actuator button female inserts with female contacts, No. (1-24) and (25-48) male inserts with male contacts, No. (1-24) and (25-48)

CMSHF 10 CMSHM 10 CMSHF 10 N CMSHM 10 N


- characteristics according to EN 61984:

16A 830V 8kV 3 16A 1000V 8kV 2 16A 720/1250V 8kV 2


- auxiliary contacts: 16A 500V 6kV

- c Sus (UL for USA and Canada), cec

- rated voltage according to UL/CSA: 600V
- insulation resistance: ≥ 10 GΩ
- ambient temperature limit: -40 °C ... +125 °C
- made of self-extinguishing thermoplastic resin UL 94V-0
- mechanical life: ≥ 500 cycles
- contact resistance: ≤ 3 mΩ
- for max. current load see the connector inserts derating diagram below; for more information see page 28

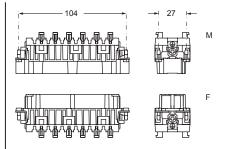

contacts side (front view)

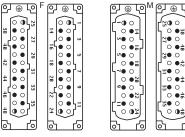


the auxiliary contacts are in the forward position upon opening

- inserts for conductor cross-sections:
- 0,14 2,5 mm² AWG 26 14 conductors stripping lenght: 9...11 mm

SQUICH®-spring connection technology

WIRING

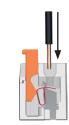

Deeply insert a stripped conductor into a round terminal.




Push the actuator button to close the terminal.

RE-OPENING



Insert a **0,5 x 3,5 mm** flat blade screwdriver in the actuator button side window and pull it up by levering down.

CMSH 20 poles connector inserts Maximum current load derating diagram

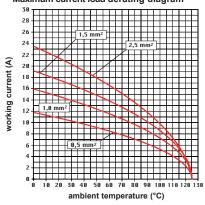

RECOMMENDED TIGHTENING TORQUE

- insert terminal screws, including PE terminal and fixing screws
- axial screw insert, MIXO series CX 02 4A / CX 02 4B
- enclosures assembly screws

Insert terminal screws, including PE terminal and fixing screws


Increasing the tightening torque of terminal screws does not considerably improve the contact resistance. The screw torques are selected according to standard EN 60999-1, to provide excellent mechanical, thermal and electric behaviour. The conductor or terminal may be damaged if the recommended values are significantly exceeded.

Screw size	Connector type	Recommended tightening torque		Recommended size of screwdriver	
		(Nm)	(lb.in)		
	LINE TERMINALS				
M2,5	CT 40, 64	0,4	3,5	0,5 x 3	
M2,6	CT 0624	0,4	3,5	0,5 x 3	
M3	CK	0,5	4,4	0,5 x 3	
M3	CDA	0,5	4,4	Ph0 or 0,6 x 3,5	
M3	CNE, CME	0,5	4,4	Ph0 or 0,8 x 4	
M3	CX 4/2, CX 4/8 (16A)	0,5	4,4	0,6 x 3,5	
M3	CX 4/8 Q (16A)	0,5	4,4	Ph0	
M4	CP	1,2	10,6	Ph1 or 0,8 x 4	
M6	CX 4/ (80A)	2,5	22,1	1,0 x 5,5	
	PE TERMINAL				
M3	CK, CQ 05, CQ 07, CQ 12	0,5	4,4	0,5x3	
M4	all series except CD 15, CD 25, CDA, CDC, CSAH, MIXO	1,2	10,6	Ph2 or 1,0 x 5,5	
M3,5	series CD 15, CD 25, CDA, CDC, CSAH	0,8	7,1	Ph1 or 0,8 x 5,5	
M3	small PE terminal, MIXO frames series	0,5	4,4	Ph1 or 1,0 x 4,5	
M4	large PE terminal, MIXO frames series	1,2	10,6	Ph1 or 1,0 x 5,5	
M4	PE terminal, MIXO ONE enclosures	1,2	10,6	Ph1 or 1,0 x 5,5	
	FASTENING SCREWS				
M3	CK, CKS, CKSH, CD 07, CD 08, CQ 05, CQ 07, CQ 12, CQ 21, CQ4 02 /02 H, CQ4 03, CX 1/2 BD	0,5	4,4	Ph1 or 0,8 x 5,5	
M3	screw for fastening inserts to enclosures of all series except T-TYPE, CQ-MQ 08 and MIXO ONE	0,8	7,1	Ph1 or 0,8 x 4	
Ø 2,9	screws for fastening "32.13" inserts CQ 04/2, CQ 08, CQ 17 to CQ-MQ 08 enclosures	0,7	6,2	Ph1	
M3	screw for fastening inserts to T-TYPE enclosures	0,5	4,4	Ph1 or 0,8 x 4	
Ø 2,9	series MIXO ONE enclosures, assembly of top and bottom parts	0,8	7,1	Ph1	
M4	CYR 16.3, CYR 24.4 cable pass-through hoods, assembly of two halves	1,2	10,6	Ph2 or 1,0 x 5,5	
M4	CYG 16 in-line joint, assembly of two halves and mounting of two bulkhead mounting housings size "77.27"	1,2	10,6	Ph2 or 1,0 x 5,5	
M5	series BIG enclosures, assembly of top and bottom parts	1,0	8,8	Ph2	

Axial screw insert, MIXO series CX 02 4A / CX 02 4B

The connections of the conductors to the female and male inserts are made via axial screw. Fully insert the stripped wire in the back of the contact (axial screw terminals are supplied fully opened); while holding the wire down, insert a 2 mm hexagonal key in the front of the contact and tighten to recommended torque. After assembling the complete connector periodically check that the contact is screwed tight by re-applying the proper tightening torque.

- Usable conductor cross-sections (EN 60228 Class 5): from 2,5 to 8 mm² (14 AWG to 10 AWG) (CX 02 4AF/M) from 6 to 10 mm² (10 AWG to 8 AWG) (CX 02 4BF/M) (extra-flexible EN 60228 class 6: 2,5... 6 mm² (14 AWG to 10 AWG)
- Use only stranded flexible copper conductors
- Do not twist the strands!
- Tightening torque with 2 mm hexagonal Allen key:
 1,5 Nm (13,3 lb.in) max for conductors with section 2,5 ... 4 mm² (14 AWG to 12 AWG)
 2 Nm (17,7 lb.in) max for conductors with section 6 ... 10 mm² (10 AWG to 8 AWG)
- Stripping length: 8⁺¹ mm

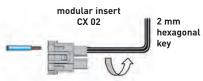



Enclosures assembly screws

In the table below, the recommended minimum and maximum tightening torque to apply to the fixing screws of ILME bulkhead mounting housings are shown, assuming the use of steel screws with 8.8 resistance class and a good fixing panel surface according to the requirements mentioned therein.

Series	Number	mber Screw size Recommended torque	Recommended torque		Flange sealing element
	of screws		(Nm)	(lb.in)	
CK/MK, CKX, CKA/MKA, CQ	2	M3	0,8 - 1,0	7,1 – 8,9	Gasket
MIXO ONE	4	M3	0,5 - 0,9	4,4 - 8,0	Gasket
CZI 15 /25	4	M3	0,8 - 1,0	7,1 – 8,9	Gasket
CHI 50	4	M4	1,2 – 1,8	10,6 - 15,9	Gasket
CHI 06 /10 /16 /24	4	M4	0,8 – 1,2	7,1 – 10,6	Gasket
CHI 32	4	M4	1,2 – 1,8	10,6 – 15,9	Gasket
CHI 48	4	M6	3,0 - 3,6	26,6 - 31,9	Gasket
CGK/MGK (IP68)	2	M4	0,8 - 1,2	7,1 – 10,6	O-ring
CGI/ MGI 06/ 10/ 16/ 24 (IP68)	2	M6	3,0 - 3,6	26,6 - 31,9	O-ring
T-TYPE, T-TYPE/H, T-TYPE/C, T-TYPE/ W	4	M4	0,8 - 1,2	7,1 – 10,6	Gasket

To guarantee the declared IP degree of protection of the housings reported in this catalogue, according to EN IEC 60529 or to the relevant Type rating per ANSI/UL 50 and 50E (for those products bearing approval to those ratings), the surface of the mounting panel must meet the following requirements (definitions are provided in ISO 4287 standard):

- Waviness Wt ≤ 0,2 mm over a distance of 200 mm (measured on the panel without load)
- Roughness Ra ≤ 16 μm

NOTE: The values of tightening torque indicated in the above table are just recommended values, that must be related – by the designer of the final application – to the resistance class of the screws (not included in the delivery), with the assumption that the mounting panel is sufficiently rigid (stiff). If the deflection of the panel, under the effect of tightening the screws, is greater than 0,7 mm over a distance of 100 mm, it is necessary to use the counter-flanges mentioned in our catalogue or the special flange gaskets available upon request (please contact our Sales Department). For the CGI/MGI IP68 enclosures the specific counter-flanges mentioned in our catalogue are always recommended.

Enclosures locking screws

Series	Number	Screw size	Recommended tightening torque Recommended size		
	of screws		(Nm)	(lb.in)	of screwdriver
CGK/MGK	2	M4	1,2	10,6	1,0 x 5,5 or 7 mm hexagonal key
CG/MG	2	M6	2,5	22,1	1,6 x 10 or 10 mm hexagonal key

RANGE OF CONDUCTOR CROSS-SECTIONAL AREA AND STRIPPING LENGTH

Connector inserts connection technique	Range of cross-sec	Stripping length		
Screw	(mm²)	AWG	(mm)	
CK	0,75 – 2,5	18 – 14	6	
CX 4/2, CX 4/8 (poles 16A) 1)	0,75 – 4	18 – 12	7	
CA 4/2, CA 4/0 (poles 10A) 17	0,75 – 2,5	18 – 14	7	
CNE 1)	0,5 – 4	20 – 12	7	
CNEX	0,25 - 2,5	24 – 14	7	
CDA 1)	0,5 – 4	20 – 12	7	
CDAX	0,25 - 2,5	24 – 14	7	
CT 0624	0,75 – 2,5	18 – 14	12	
CT 40 and 64	0,75 – 2,5	18 – 14	12	
CME 1)	0,5 – 4	20 – 12	7	
CMEX	0,5 – 2,5	20 – 14	7	
CP ¹⁾	0,75 – 6	18 – 10	10,5	
CX 4/ (80A poles)	4 – 16	12 – 5	14	
Crimp				
MIXO (5A), CX 25 IB	0,08 - 0,75	28 – 18	4	
CQ 21	0,08 - 0,5	28 – 20	4	
CDD, CD, MIXO (10A), CQ 12, CQ 07	0,14 – [2,5]*	26 – 14	8 – *[6 for 2,5 mm ²]	
CCE, CDC, CMCE, CQ, CQE, CQEE, MIXO (16A)	0,14 – 4	26 – 12	7,5	
CX, MIXO (40A), CQ4 03	1,5 – 2,5	16 – 14	9	
CX, MIXO (40A), CQ4 03	4 – 6	12 – 10	9.6	
MIXO (70A)	10 – 25	7 – 4	15	
MIXO (100A), CX 6/6	10 – 35	7 - 2	15	
MIXO (200A)	16 – 70	6 - 2/0	15	
Spring				
CSE, CSH, CTSE 0624, CMSH, MIXO [CX 05 S 2), CX 05 SH], CSS	0,14 - 2,5	26 – 14	9 - 11	
CTS 40/64	0,14 – 2,5 unprepared 0,14 – 1 prepared	26 – 14 unprepared 26 – 18 prepared	9 - 11	
CKS, CKSH, CDS, CDSH, CSAH	0,14 – 2,5 unprepared 0,14 – 1,5 prepared	26 – 14 unprepared 26 – 16 prepared	9 - 11	

¹⁾ For CNE, CDA, CP, CME, "CX 4/8 – pole 16A" series connectors with screw terminal and conductor protection plate, the use of ferrules is not necessary (= unprepared conductor).

The use of ferrules (= prepared conductor) causes a reduction in maximum useful cross-section to the lower size (e.g. 4 mm² unprepared - 2,5 mm² prepared).

²⁾ Available upon request.

LOAD CURVES


The permitted current carrying capacity for connectors is variable: it becomes lower with the increase of the number of poles and of the ambient temperature in which the connector is installed and it depends upon the thermal properties of the material used for the contacts and the insulating parts including those of the type of conductor used. The current carrying capacity is obtained from the load curves which are constructed according to standard IEC 60512-5-2 for currents circulating simultaneously in all poles.

The limit current curves express current values that determine the achievement of the upper limit temperature of the materials. The choice of the permanent load applicable on the contacts **must be made within the field of operation possible delimited by the above mentioned curves.**

Since use of connectors at the limit values of their characteristics is not recommended, the **base curve** is de-rated. The reduction of the load currents to 80% defines the correction curve where both the maximum permissible contact resistances and the inaccuracy of the temperature measurements are sufficiently taken into consideration.

The correction curve represents the final **limit current curve (load curve)** as defined by standard IEC 60512-5-2. It therefore bears in consideration the differences between the various connector inserts, as well as errors in the temperature measurements.

All the load curves presented in this catalogue include the correction. See figure below.

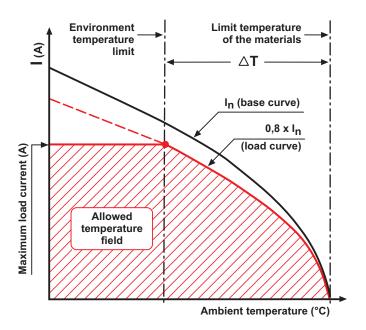

Legend

Maximum load current (A)

Value for which the connector reaches the upper limit temperature of the material at the corresponding ambient temperature intersected on the load curve.

Limit temperature of the materials

Value determined by the characteristics of the material used. The sum of the environmental temperature and the increase of the ΔT (temperature rise) caused by the current flow must not exceed the limit temperature of the materials.

Environment temperature limit

The environmental conditions must not exceed this value. It may be known and determines the maximum load current, or it may be directly obtained from the load curve.

Base curve

Set of current and temperature values obtained from laboratory tests and influenced by the connector's characteristics (number of poles, construction shape, thermal conductivity of the materials, etc.) and the cross-section of the conductor used.

Load curve (limit current curve)

Obtained from the base curve via the safety coefficient.

ΔT (temperature rise)

Temperature rise produced by a permanent current circulating through all the poles of a connector coupling; difference between the upper limit temperature of the material and the ambient temperature obtained on the limit current curve.